

INITIAL SEISMIC ASSESSMENT REPORT (ISA PLUS)

Max Fashions and Pascoes The Jewellers

53 Esk Street, Invercargill



Client Name: HWCP Management Limited

BMC Reference: 1711-2266




Date Issued: 9/04/2018

Quality Statement and Document Control

This Initial Seismic Assessment report has been prepared for HWCP Management Limited by Batchelar McDougall Consulting Limited. No liability is accepted by this company or any employee or sub-consultant of this company with respect to its use by any other parties.

This disclaimer shall apply notwithstanding that the documents may be made available to other persons for an application for permission or approval to fulfil a legal requirement.

Issue Register:

Revision	Date	Description		
A	9/04/2018	ISA (Plus)		
		Prepared by	Reviewed by	Approved by
	Name	Matt Stewart	Andrew Marriott	Graham McDougall
	Signature	 BSCE (USA-CA), PE (USA-CA), CMEngNZ	 BE, CPEng, CMEngNZ, IntPE(NZ), MICOMOS	 Director

Revision History:

Rev. No	Date	Issue Description	Prepared by	Reviewed by

Contents:

1	Executive Summary	3
2	Scope of Our Engagement	4
3	Building Description.....	5
3.1	General Overview.....	5
3.2	Construction Materials & Configuration	6
3.3	Lateral Load Resisting Structural System.....	7
3.4	Foundations & Geotechnical	8
4	Building Inspection	9
4.1	Documentation	9
4.2	Observations and/or Damage	9
5	Assessment.....	14
5.1	Specific Calculations / Engineering Assessment	14
5.2	IEP Spreadsheet Calculations	14
6	Seismic Restraint of Non-Structural Items	15
7	Continued Occupancy Recommendations	15
8	Conclusions.....	15
APPENDIX A - NZSEE IEP Spreadsheet & Out-of-Plane Wall Calculation		A

1 Executive Summary

The following report summarises the findings of an Initial Seismic Assessment (ISA Plus) of the building at 53 Esk Street, Invercargill. This building has “Tier 2” heritage status in the “Proposed Invercargill City District Plan”, dated January 2017. Tier 2 heritage status signifies a site of local significance.

The two-storey building is constructed of unreinforced masonry (URM) perimeter walls and timber floor and roof framing. The building was constructed circa 1900. It was renovated in 1934 to an art deco style by Allan C Ford for the New Zealand Insurance Company. The building is located in the Invercargill CBD. This location is a ‘medium’ seismic risk region with a seismic hazard factor of 0.17. For comparison, Christchurch has a seismic hazard design value of 0.30 and is a ‘high’ seismic risk region, while Dunedin has a seismic hazard value of 0.13 and is a ‘low’ seismic risk region.

Documentation available to Batchelar McDougall Consultants Limited (BMC) for the purposes of this assessment is summarised in Section 4.1. This assessment is based on these documents and site visit observations only.

For the purposes of this evaluation, the building has been assessed as a structure of Importance Level 2 (IL2) – Normal Building.

BMC have completed an NZSEE Initial Evaluation Procedure (IEP) spreadsheet. In addition, BMC has provided an initial assessment of the building and carried out a calculation of the out-of-plane performance of a critical wall.

From this assessment, the building is considered to have a lateral load carrying capacity of 15-20% New Building Standard (%NBS) for an IL2 building as follows,

Loading direction	Building %NBS (IL2)	Seismic Grade	Limiting performance
North-South (Longitudinal)	15% NBS	E	Out-of-plane capacity of shopfront URM wall (north wall, facing Esk Street)
East-West (Transverse)	15-20% NBS	E	In-plane soft storey at the shopfront

Refer to Section 5 for explanation and summary of assessment.

A ‘Desk Top’ geotechnical assessment from nearby sites has been referenced in relation to likely geotechnical conditions for this site. The building is assumed to have shallow strip footing foundations which will likely be subject to some differential settlement as a result of liquefaction under a significant (ULS) seismic event.

Our ISA Plus found that the building at 53 Esk Street, Invercargill has a capacity less than 34%NBS (IL2), and the building, therefore, is considered to be potentially Earthquake Prone as defined in the Building Act.

Note the ISA Plus is considered to provide a relatively quick, high-level and mostly qualitative measure of the building's performance. If a more defined level of performance is required then a Detailed Seismic Assessment (DSA) would need to be carried out.

2 Scope of Our Engagement

As requested by HWCP Management Limited, Batchelar McDougall Consulting Limited (BMC) has undertaken a comprehensive Initial Seismic Assessment (ISA Plus) of the seismic capacity of the building at the above noted address.

The seismic assessment and reporting have been undertaken in accordance with the qualitative procedures detailed in "The Seismic Assessment of Existing Buildings, Technical Guidelines for Engineering Assessments" issued by the Ministry of Business, Innovation and Employment (MBIE) and now cited in the Building (Earthquake-prone buildings) Amendment Act 2016 (which has now been integrated into the Building Act 2004) with reference to potentially earthquake prone buildings. BMC have included a simple calculation / assessment of an element of the building form(s) or structure(s) that BMC have assessed as limiting the global seismic capacity of the building.

This structural assessment includes:

- Review of existing building plans or production of a scale layout plan and review of any prior reports, if available.
- Undertaking interior and exterior visual inspection of exposed elements on-site, where access is available.
- Consideration of the general established geotechnical evidence for the site (from the initial 'Desktop Study' relevant to the CBD block by Geosolve Limited).
- Completion of an Initial Evaluation Procedure (IEP) spreadsheet(s).
- Engineering assessment and/or calculation of a primary or critical structural element that is considered to limit the global seismic capacity of the building.
- Production of a summary report.

The assessment is made with regard to Clause B1 – Structure of the New Zealand Building Code. No other Building Code Clauses have been assessed by this report.

This structural assessment is based on the visual evidence and indications present at the time of inspection. No specific invasive investigation work has been carried out (although wall thicknesses and wall/parapet heights may be determined). The findings of this report may therefore be subject to revision pending further and more detailed investigation or assessment and/or deterioration of elements from earthquake or ground settlement. This report does not address any hidden or latent defects that may have been incorporated in the original design and construction.

This assessment has been restricted to structural aspects only. Waterproofing elements, electrical and mechanical equipment, fire protection and safety systems, service connections, water supplies and sanitary fittings have not been reviewed, and secondary elements such as internal fit out have not been reviewed.

The scope of this evaluation is limited to the initial or first stage assessment of the potential performance of the building in an earthquake ONLY. No assessment has been made of other load cases such as wind, snow and gravity.

BMC's professional services are performed using a degree of care and skill normally exercised, under similar circumstances, by reputable consultants practicing in this field at this time. No other warranty, expressed or implied, is made as to the professional advice presented in this report.

This report is provided solely for use by HWCP Management Limited and shall not be relied on by any other parties without written approval from BMC.

3 Building Description

3.1 General Overview

The building is located at 53 Esk Street, Invercargill, as shown below in Figure 1. The building is a two-storey unreinforced masonry (URM) brick structure with untenanted offices on the first floor and two tenants on the ground floor - Max Fashions and Pascoes.

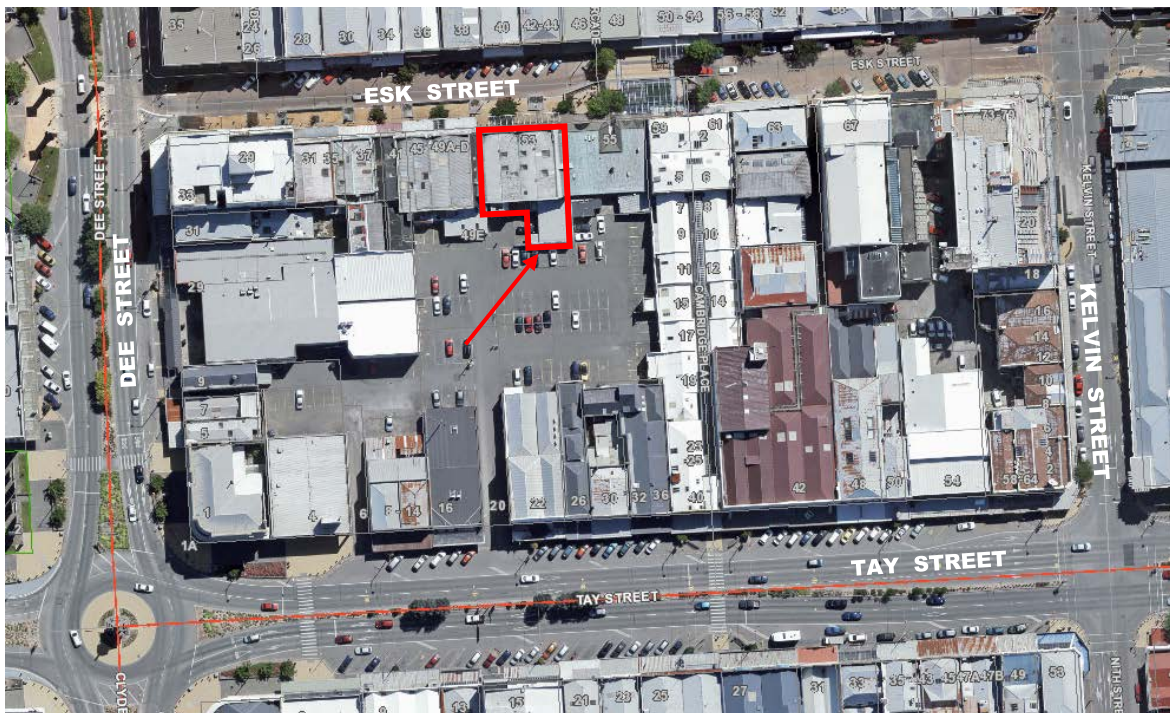


Figure 1 - Location of 53 Esk Street, Invercargill

The building was constructed circa 1900 for Charles Gray as a music studio. An art deco style renovation was done by Allan Ford in 1934 for the New Zealand Insurance Company. In 1978, the interior of the building was renovated and a single storey extension was added to the rear of the building.

The shopfront, facing Esk Street, has full height glazing at ground level. The shopfront façade at the first floor features semi-circular windows and pilasters and a plain parapet. A glass canopy extends the full width of the shopfront. The building has been classified by Invercargill City Council as a site of local significance, giving it a "Tier 2" heritage status in the "Proposed Invercargill City District Plan", dated January 2017. The building description is summarized below in Table 1.

Building Feature	Description
Building address:	53 Esk Street, Invercargill
Overall plan dimensions:	17.7m x 18.6m original 2 storey building 12.3m by 3.4m single storey extension at rear of building (southeast corner)
Number of storeys:	2
Gross floor area (approximate):	750m ²
Building history:	Built circa 1900. Renovation by Allan Ford in 1934. Single storey addition to rear of building by ER Garden in 1978.
Archive Plan Availability	1978 structural drawings - "New Addition at Rear and Proposed Layout" by E.R. Garden and Partners
Occupancy:	First floor = untenanted Ground floor = retail
Importance Classification: (AS/NZS 1170.0:2002: Table 3.2)	IL2 Normal building
Heritage Classification:	Tier 2

Table 1: Building Description

3.2 Construction Materials & Configuration

The original two-storey building is almost square in plan. A single-storey addition extends off the south wall. The shopfront of the building is at the north end of the building facing Esk Street. The side walls are on the east and west sides of the building. The ground floor plan and first floor plan are shown below in Figure 2. These plans are from the 1978 structural drawings for "New Addition at Rear and Proposed Layout" by E.R. Garden and Partners.

The perimeter side walls and rear wall are full height and constructed of unreinforced masonry (URM). At the shopfront, the ground floor is "open" with URM wall/piers above. The URM wall/piers above are likely supported by steel beams spanning between steel posts and URM walls/piers across the shopfront. A glass canopy with steel framing cantilevers from the shopfront wall.

The roof is constructed of corrugated iron roofing on timber purlins spanning between timber trusses. The timber trusses are supported on perimeter URM side walls and interior supports.

The first floor is assumed to be constructed of timber planks on timber joists that span between the perimeter side walls and the interior supports.

The ground floor construction was identified as slab on grade. The URM brick walls are assumed to be supported on concrete footings.

wall was retrofitted with steel strip plate anchors along the first floor and roof levels. See photo of anchors in Figure 3. Plate anchors were not seen along first floor or roof level diaphragm in either of the other three walls.

For seismic loads in the north south direction (longitudinal direction), the lateral loads are resisted by the perimeter side walls.

For seismic loads in the east west direction (transverse direction), the lateral loads are resisted by the rear wall.



Figure 3 - Steel strip plate anchors on the west wall of the building, viewed from Barclay Lane alleyway facing south

3.4 Foundations & Geotechnical

There are signs of some settlement in the foundations in the form of wall cracking to the first-floor wall above the shopfront. Foundation details are unknown. It is assumed that the URM walls sit on concrete footings.

A 'Desk Top' geotechnical study titled Invercargill CBD Project Stage 1 dated February 2018 by Geosolve Limited (Ref: 171019) has been completed. This study focussed on the likely ground conditions for the Old Government Life & Old Southland Times buildings but does relate generally to the CBD block as a whole.

Key findings from the Geosolve report that are likely to relate to this building assessment are:

- Ground / Soil Class D is to be used for the purposes of seismic assessment.
- Some liquefaction induced differential settlement is likely in a significant (ULS) seismic event.
- Bearing conditions for typical strip footings are less than 'good ground' as defined by NZS3604 (approximately half). Note BMC has not checked actual foundation bearing pressures for this building.

4 Building Inspection

4.1 Documentation

Documentation received by BMC that was considered relevant to this report includes: -


Description	Revision	Issue Date
N.Z.I. Building Alterations "New Addition at Rear and Proposed Layout" By E.R. Garden & Partners Consulting Engineers	1	1978
Invercargill City: Central City Area Heritage Buildings Re-Assessment 2016 By: Dr. Andrea Farminer and Robin Miller	N/A	2016

4.2 Observations and/or Damage

The building was inspected by Andrew Marriott and Charlotte Corston of BMC on 26/02/2018. This was a visual inspection only. The inspection included both the internal and external accessible areas of the building. No invasive investigations were carried out.


At the first-floor level there was a notable amount of sag. The boards sag between joists and joists sag between supports. Cracking was noted in the URM walls. Water damage was observed to the ceiling lining at roof level. At shopfront, the wall above the lintel at first floor level is cracked indicating potential settlement.

The following photo images and observations and specific comments relate to the inspection. A complete photo record of the inspection is available on request.

No#	Photo	Comments
1		Potential soft storey at shopfront.

No#	Photo	Comments
2		<p>At the east wall of the building, no evidence of a seismic gap.</p>
3		<p>Cracking in URM shopfront parapet.</p>

No#	Photo	Comments
4		Cracking in south URM wall on west side, near roof line.
5		Damage to ceiling lining due to water ingress.

No#	Photo	Comments
6		<p>Along west wall -</p> <p>Anchor tie between URM wall and roof truss. 16mm bolts from strap into timber roof truss. Truss at 2.6m centres.</p>



No#	Photo	Comments
7		First floor URM wall.
8		Cracking in URM wall at shopfront - potentially from settlement in the foundations.

Table 2 – Photos of observations and damage

5 Assessment

5.1 Specific Calculations / Engineering Assessment

In the longitudinal direction (north-south direction), the limiting element of the lateral load carrying capacity is the out-of-plane capacity of the URM wall at the shopfront and at the rear of the building. The out-of-plane capacity of this wall was calculated to be approximately 15%NBS (IL2). The shopfront wall was taken as 325mm thick, 7m height (first floor to top of parapet) and supported on double steel beams above the open shopfront. The wall appears to have no positive connection to the timber diaphragm at first floor or at roof level. As such, the wall essentially cantilevers from its support point with little to no lateral support above. For out-of-plane wall calculation, refer to Appendix A.

In the transverse direction (east-west direction), there is a soft storey critical structural weakness. A soft storey in a building occurs when a significantly more flexible building level supports a more rigid building level. This occurs at the shopfront, where a relatively heavy rigid first floor façade is supported by a “open” ground floor framing with no distinct lateral force resisting elements. At ground level, in the transverse direction, the only lateral load resisting element is the URM wall at the rear of the building. It is estimated that the capacity of the building in the transverse direction is approximately 15-20%NBS (IL2).

The building was found to have a lateral load carrying capacity of 15%NBS for an IL2 building. The limiting elements in the strength of the lateral load capacity of the building are the out-of-plane wall capacities of the shopfront URM wall (north wall) and the soft storey critical structural weakness at the shopfront.

5.2 IEP Spreadsheet Calculations

The NZ Society of Earthquake Engineers (NZSEE) has developed an assessment calculation (the IEP Spreadsheet) to be used in a preliminary estimation of the seismic capacity (Percentage of New Build Standard (%NBS)) of a building. This is primarily based on comparing the current seismic design Loadings Code (NZS1170.5) in 2018 with the seismic design load at the time the building was designed. It assumes that the original design was built to at least 100%NBS of the design load at this time. It allows for other ‘engineering judgement’ and observation factors to be incorporated but the process is at best a preliminary estimation.

BMC has carried out an IEP assessment for this building. The results were 15%NBS (IL2). The lateral capacity of the building is limited by the soft storey weakness and the age of the building.

The IEP assessment of this building therefore indicates an overall score of 15%NBS (IL2) corresponding to a ‘Grade E’ building as defined by the New Zealand Society for Earthquake Engineering (NZSEE) building grading scheme. This is below the threshold for earthquake prone buildings (34%NBS) and below the threshold for earthquake risk buildings (67%NBS) as recommended by the NZSEE. The IEP Spreadsheets are (for both parts of the building) included as Appendix A.

6 Seismic Restraint of Non-Structural Items

During an earthquake, the safety of people can be put at risk due to non-structural items falling on them. These items should be adequately seismically restrained, where possible, to the NZS 4219:2009 "The Seismic Performance of Engineering Systems in Buildings".

An assessment has not been made of the bracing of the false ceilings, in-ceiling ducting, services and plant or contents. These issues are outside the scope of this initial assessment but could be the subject of another investigation. False (or suspended) ceilings exist on both ground and first floor levels of this building.

7 Continued Occupancy Recommendations

Based on our assessment of the building, BMC considers continued occupancy is appropriate for 6-12 months *subject to the conditions of the Building (Earthquake Prone Buildings) Amendment Act 2016*.

If required, a Detailed Seismic Assessment (DSA) or a more detailed assessment could be carried out with intrusive investigation work into the nature and capacity of the timber framing connections to the front and rear URM walls at the roof and first floor level. This more detailed assessment could enable an understanding of other aspects of its seismic performance and potentially raise the lateral capacity of the building to above 34%NBS.

8 Conclusions

Based on our assessment, the building has a seismic load carrying capacity of less than 34%NBS and the building, therefore, is considered to be potentially Earthquake Prone as defined by the Building Act.

This building has "Tier 2" heritage status in the "Proposed Invercargill City District Plan", dated January 2017.

If a more defined level of performance is required, then a DSA would need to be carried out.

For more summary comments, refer to the Executive Summary.

APPENDIX A - NZSEE IEP Spreadsheet & Out-of-Plane Wall Calculation


Initial Evaluation Procedure (IEP) Assessment - Completed for {Client/TA}**Page 1**

WARNING!! This initial evaluation has been carried out solely as an initial seismic assessment of the building following the procedure set out in the "The Seismic Assessment of Existing Buildings" Technical Guidelines for Engineering Assessments, July 2017. This spreadsheet must be read in conjunction with the limitations set out in the accompanying report, and should not be relied on by any party for any other purpose. Detailed inspections and engineering calculations, or engineering judgements based on them, have not been undertaken, and these may lead to a different result or seismic grade.

Street Number & Name:	53 Esk Street	Job No.:	1711-2266
AKA:		By:	Matt Stewart
Name of building:	Max Fashion/Pascoes Building	Date:	2/04/2018
City:	Invercargill	Revision No.:	A

Table IEP-1 Initial Evaluation Procedure Step 1**Step 1 - General Information****1.1 Photos (attach sufficient to describe building)**

NOTE: THERE ARE MORE PHOTOS ON PAGE 1a ATTACHED

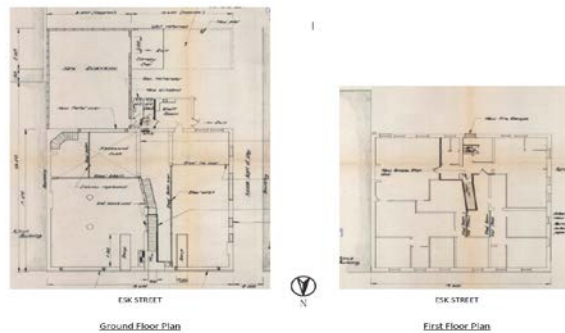1.2 Sketches (plans etc, show items of interest)

NOTE: THERE ARE MORE SKETCHES ON PAGE 1a ATTACHED

1.3 List relevant features (Note: only 10 lines of text will print in this box. If further text required use Page 1a)

Refer to ISA Plus report

1.4 Note information sources

Tick as appropriate

Visual Inspection of Exterior
Visual Inspection of Interior
Drawings (note type)

<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>

Specifications
Geotechnical Reports
Other (list)

<input type="checkbox"/>
<input checked="" type="checkbox"/>
<input type="checkbox"/>

NZI Building Alterations - Proposed Layout and New Addition at Rear by ER Garden & Partners - Issue date: 1978

Initial Evaluation Procedure (IEP) Assessment - Completed for {Client/TA}

Page 2

Street Number & Name:	53 Esk Street	Job No.:	1711-2266
AKA:		By:	Matt Stewart
Name of building:	Max Fashion/Pascoes Building	Date:	2/04/2018
City:	Invercargill	Revision No.:	A

Table IEP-2 Initial Evaluation Procedure Step 2

Step 2 - Determination of (%NBS)_b

(Baseline (%NBS) for particular building - refer Section B5)

2.1 Determine nominal (%NBS) = (%NBS)_{nom}

	Longitudinal	Transverse
a) Building Strengthening Data		
Tick if building is known to have been strengthened in this direction	<input type="checkbox"/>	<input type="checkbox"/>
If strengthened, enter percentage of code the building has been strengthened to	N/A	N/A
b) Year of Design/Strengthening, Building Type and Seismic Zone		
Pre 1935	<input checked="" type="radio"/>	<input checked="" type="radio"/>
1935-1965	<input type="radio"/>	<input type="radio"/>
1965-1976	<input type="radio"/>	<input type="radio"/>
1976-1984	<input type="radio"/>	<input type="radio"/>
1984-1992	<input type="radio"/>	<input type="radio"/>
1992-2004	<input type="radio"/>	<input type="radio"/>
2004-2011	<input type="radio"/>	<input type="radio"/>
Post Aug 2011	<input type="radio"/>	<input type="radio"/>
Building Type:	Others	Others
Seismic Zone:	Not applicable	Not applicable
c) Soil Type		
From NZS1170.5:2004, Cl 3.1.3 :	D Soft Soil	D Soft Soil
From NZS4203:1992, Cl 4.6.2.2 : (for 1992 to 2004 and only if known)	Not applicable	Not applicable
d) Estimate Period, T		
Comment:		
URM Walls	h _n = 10 A _c = 1.00	10 m 1.00 m ²
Moment Resisting Concrete Frames:	<input type="radio"/>	<input type="radio"/>
Moment Resisting Steel Frames:	<input type="radio"/>	<input type="radio"/>
Eccentrically Braced Steel Frames:	<input type="radio"/>	<input type="radio"/>
All Other Frame Structures:	<input type="radio"/>	<input type="radio"/>
Concrete Shear Walls	<input type="radio"/>	<input type="radio"/>
Masonry Shear Walls:	<input type="radio"/>	<input type="radio"/>
User Defined (input Period):	<input checked="" type="radio"/>	<input checked="" type="radio"/>
Where h _n = height in metres from the base of the structure to the uppermost seismic weight or mass.	T: 0.40	0.40
e) Factor A: Strengthening factor determined using result from (a) above (set to 1.0 if not strengthened)	Factor A: 1.00	1.00
f) Factor B: Determined from NZSEE Guidelines Figure 3A.1 using results (a) to (e) above	Factor B: 0.03	0.03
g) Factor C: For reinforced concrete buildings designed between 1976-84 Factor C = 1.2, otherwise take as 1.0.	Factor C: 1.00	1.00
h) Factor D: For buildings designed prior to 1935 Factor D = 0.8 except for Wellington and Napier (1931-1935) where Factor D may be taken as 1.0, otherwise take as 1.0.	Factor D: 0.80	0.80
(%NBS) _{nom} = AxBxCxD	(%NBS) _{nom} 2%	2%

WARNING!! This initial evaluation has been carried out solely as an initial seismic assessment of the building following the procedure set out in "The Seismic Assessment of Existing Buildings" Technical Guidelines for Engineering Assessments, July 2017. This spreadsheet must be read in conjunction with the limitations set out in the accompanying report, and should not be relied on by any party for any other purpose. Detailed inspections and engineering calculations, or engineering judgements based on them, have not been undertaken, and these may lead to a different result or seismic grade.

Initial Evaluation Procedure (IEP) Assessment - Completed for {Client/TA}

Page 3

Street Number & Name:	53 Esk Street	Job No.:	1711-2266
AKA:		By:	Matt Stewart
Name of building:	Max Fashion/Pascoes Building	Date:	2/04/2018
City:	Invercargill	Revision No.:	A

Table IEP-2 Initial Evaluation Procedure Step 2 continued

2.2 Near Fault Scaling Factor, Factor E

If $T \leq 1.5\text{sec}$, Factor E = 1a) Near Fault Factor, $N(T,D)$

(from NZS1170.5:2004, Cl 3.1.6)

Longitudinal

N(T,D): 1

Transverse

1

b) Factor E

 $= 1/N(T,D)$

Factor E: 1.00

1.00

2.3 Hazard Scaling Factor, Factor F

a) Hazard Factor, Z , for site

Location: Invercargill

Refer right for user-defined locations

 $Z = 0.17$ (from NZS1170.5:2004, Table 3.3) $Z_{1992} = 0.68$ (NZS4203:1992 Zone Factor from accompanying Figure 3.5(b)) $Z_{2004} = 0.17$ (from NZS1170.5:2004, Table 3.3)

b) Factor F

For pre 1992

 $= 1/Z$

For 1992-2011

 $= Z_{1992}/Z$

For post 2011

 $= Z_{2004}/Z$

Factor F: 5.88

5.88

2.4 Return Period Scaling Factor, Factor G

a) Design Importance Level, I

(Set to 1 if not known. For buildings designed prior to 1965 and known to be designed as a public building set to 1.25. For buildings designed 1965-1976 and known to be designed as a public building set to 1.33 for Zone A or 1.2 for Zone B. For 1976-1984 set I value.)

 $I = 1$

1

b) Design Risk Factor, R_o

(set to 1.0 if other than 1976-2004, or not known)

 $R_o = 1$

1

c) Return Period Factor, R

(from NZS1170.0:2004 Building Importance Level)

Choose Importance Level

☐ ☒ ☐ ☐ $R = 1.0$

1.0

d) Factor G

 $= I R_o / R$

Factor G: 1.00

1.00

2.5 Ductility Scaling Factor, Factor H

a) Available Displacement Ductility Within Existing Structure

Comment:

 $\mu = 1.25$

1.25

b) Factor H

For pre 1976 (maximum of 2)
For 1976 onwards k_u
 $= 1.14$
 $= 1$

Factor H: 1.14

 k_u
 $= 1.14$
 $= 1$

1.14

(where k_u is NZS1170.5:2004 Inelastic Spectrum Scaling Factor, from accompanying Table 3.3)

2.6 Structural Performance Scaling Factor, Factor I

a) Structural Performance Factor, S_p

(from accompanying Figure 3.4)

Tick if light timber-framed construction in this direction

☐
 $S_p = 0.93$ ☐
 0.93

b) Structural Performance Scaling Factor

 $= 1/S_p$

Factor I: 1.08

1.08

Note Factor B values for 1992 to 2004 have been multiplied by 0.67 to account for S_p in this period2.7 Baseline %NBS for Building, (%NBS)_b(equals (%NBS)_{nom} x E x F x G x H x I)

17%

17%

WARNING!! This initial evaluation has been carried out solely as an initial seismic assessment of the building following the procedure set out in "The Seismic Assessment of Existing Buildings" Technical Guidelines for Engineering Assessments, July 2017. This spreadsheet must be read in conjunction with the limitations set out in the accompanying report, and should not be relied on by any party for any other purpose. Detailed inspections and engineering calculations, or engineering judgements based on them, have not been undertaken, and these may lead to a different result or seismic grade.

Initial Evaluation Procedure (IEP) Assessment - Completed for {Client/TA}

Page 4

Street Number & Name:	53 Esk Street	Job No.:	1711-2266
AKA:		By:	Matt Stewart
Name of building:	Max Fashion/Pascoes Building	Date:	2/04/2018
City:	Invercargill	Revision No.:	A

Table IEP-3 Initial Evaluation Procedure Step 3

Step 3 - Assessment of Performance Achievement Ratio (PAR)

(Refer Appendix B - Section B3.2)

a) Longitudinal Direction

potential CSWs	Effect on Structural Performance (Choose a value - Do not interpolate)	Factors
3.1 Plan Irregularity Effect on Structural Performance <input type="radio"/> Severe <input type="radio"/> Significant <input checked="" type="radio"/> Insignificant Comment		Factor A 1.0
3.2 Vertical Irregularity Effect on Structural Performance <input type="radio"/> Severe <input type="radio"/> Significant <input checked="" type="radio"/> Insignificant Comment		Factor B 1.0
3.3 Short Columns Effect on Structural Performance <input type="radio"/> Severe <input type="radio"/> Significant <input checked="" type="radio"/> Insignificant Comment		Factor C 1.0
3.4 Pounding Potential (Estimate D1 and D2 and set D = the lower of the two, or 1.0 if no potential for pounding, or consequences are considered to be minimal)		

a) Factor D1: - Pounding Effect

Note:
 Values given assume the building has a frame structure. For stiff buildings (eg shear walls), the effect of pounding may be reduced by taking the coefficient to the right of the value applicable to frame buildings.

Factor D1 For Longitudinal Direction: 1.0

Table for Selection of Factor D1	Severe	Significant	Insignificant
	0 < Sep < .005H	.005 < Sep < .01H	Sep > .01H
Alignment of Floors within 20% of Storey Height	<input type="radio"/>	<input type="radio"/>	<input checked="" type="radio"/>
Alignment of Floors not within 20% of Storey Height	<input type="radio"/> 0.4	<input type="radio"/> 0.7	<input type="radio"/> 0.8
Comment			

b) Factor D2: - Height Difference Effect

Factor D2 For Longitudinal Direction: 1.0

Table for Selection of Factor D2	Severe	Significant	Insignificant
	0 < Sep < .005H	.005 < Sep < .01H	Sep > .01H
Height Difference > 4 Storeys	<input type="radio"/> 0.4	<input type="radio"/> 0.7	<input type="radio"/>
Height Difference 2 to 4 Storeys	<input type="radio"/> 0.7	<input type="radio"/> 0.9	<input type="radio"/>
Height Difference < 2 Storeys	<input type="radio"/>	<input type="radio"/>	<input checked="" type="radio"/>
Comment			

Factor D 1.0

3.5 Site Characteristics - Stability, landslide threat, liquefaction etc as it affects the structural performance from a life-safety perspective

Effect on Structural Performance <input type="radio"/> Severe <input type="radio"/> Significant <input checked="" type="radio"/> Insignificant	Factor E 1.0
Comment	

3.6 Other Factors - for allowance of all other relevant characteristics of the building

For ≤ 3 storeys - Maximum value 2.5
 otherwise - Maximum value 1.5.
 No minimum.

Factor F 1.0

Record rationale for choice of Factor F:

3.7 Performance Achievement Ratio (PAR)
 (equals A x B x C x D x E x F)

 PAR
 Longitudinal 1.00

WARNING!! This initial evaluation has been carried out solely as an initial seismic assessment of the building following the procedure set out in "The Seismic Assessment of Existing Buildings" Technical Guidelines for Engineering Assessments, July 2017. This spreadsheet must be read in conjunction with the limitations set out in the accompanying report, and should not be relied on by any party for any other purpose. Detailed inspections and engineering calculations, or engineering judgements based on them, have not been undertaken, and these may lead to a different result or seismic grade.

Initial Evaluation Procedure (IEP) Assessment - Completed for {Client/TA}

Page 5

Street Number & Name:	53 Esk Street	Job No.:	1711-2266
AKA:		By:	Matt Stewart
Name of building:	Max Fashion/Pascoes Building	Date:	2/04/2018
City:	Invercargill	Revision No.:	A

Table IEP-3 Initial Evaluation Procedure Step 3

Step 3 - Assessment of Performance Achievement Ratio (PAR)

(Refer Appendix B - Section B3.2)

b) Transverse Direction

potential CSWs	Effect on Structural Performance (Choose a value - Do not interpolate)	Factors
3.1 Plan Irregularity Effect on Structural Performance <input type="radio"/> Severe <input type="radio"/> Significant <input checked="" type="radio"/> Insignificant Comment	Factor A	1.0
3.2 Vertical Irregularity Effect on Structural Performance <input type="radio"/> Severe <input checked="" type="radio"/> Significant <input type="radio"/> Insignificant Potential soft story	Factor B	0.7
3.3 Short Columns Effect on Structural Performance <input type="radio"/> Severe <input type="radio"/> Significant <input checked="" type="radio"/> Insignificant Comment	Factor C	1.0
3.4 Pounding Potential (Estimate D1 and D2 and set D = the lower of the two, or 1.0 if no potential for pounding, or consequences are considered to be minimal)		

a) Factor D1: - Pounding Effect

Note:
 Values given assume the building has a frame structure. For stiff buildings (eg shear walls), the effect of pounding may be reduced by taking the coefficient to the right of the value applicable to frame buildings.

Factor D1 For Transverse Direction: 1.0

Table for Selection of Factor D1	Severe	Significant	Insignificant
	0 < Sep < .005H	.005 < Sep < .01H	Sep > .01H
Alignment of Floors within 20% of Storey Height	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Alignment of Floors not within 20% of Storey Height	<input type="radio"/> 0.4	<input type="radio"/> 0.7	<input type="radio"/> 0.8
Comment			

b) Factor D2: - Height Difference Effect

Factor D2 For Transverse Direction: 1.0

Table for Selection of Factor D2	Severe	Significant	Insignificant
	0 < Sep < .005H	.005 < Sep < .01H	Sep > .01H
Height Difference > 4 Storeys	<input type="radio"/> 0.4	<input type="radio"/> 0.7	<input type="radio"/>
Height Difference 2 to 4 Storeys	<input type="radio"/> 0.7	<input type="radio"/> 0.9	<input type="radio"/>
Height Difference < 2 Storeys	<input checked="" type="radio"/>	<input type="radio"/>	<input type="radio"/>
Comment			

Factor D 1.0

3.5 Site Characteristics - Stability, landslide threat, liquefaction etc as it affects the structural performance from a life-safety perspective

Effect on Structural Performance <input type="radio"/> Severe <input type="radio"/> Significant <input checked="" type="radio"/> Insignificant	Factor E	1.0
Comment		

3.6 Other Factors - for allowance of all other relevant characteristics of the building

For ≤ 3 storeys - Maximum value 2.5
 otherwise - Maximum value 1.5.
 No minimum.

Factor F 1.00

Record rationale for choice of Factor F:

3.7 Performance Achievement Ratio (PAR)
(equals A x B x C x D x E x F)

PAR
 Transverse 0.70

WARNING!! This initial evaluation has been carried out solely as an initial seismic assessment of the building following the procedure set out in "The Seismic Assessment of Existing Buildings" Technical Guidelines for Engineering Assessments, July 2017. This spreadsheet must be read in conjunction with the limitations set out in the accompanying report, and should not be relied on by any party for any other purpose. Detailed inspections and engineering calculations, or engineering judgements based on them, have not been undertaken, and these may lead to a different result or seismic grade.

Initial Evaluation Procedure (IEP) Assessment - Completed for {Client/TA}

Page 6

Street Number & Name:	53 Esk Street	Job No.:	1711-2266
AKA:		By:	Matt Stewart
Name of building:	Max Fashion/Pascoes Building	Date:	2/04/2018
City:	Invercargill	Revision No.:	A

Table IEP-4 Initial Evaluation Procedure Steps 4, 5, 6 and 7

Step 4 - Percentage of New Building Standard (%NBS)

	Longitudinal	Transverse
4.1 Assessed Baseline %NBS (%NBS) _b (from Table IEP - 1)	17%	17%
4.2 Performance Achievement Ratio (PAR) (from Table IEP - 2)	1.00	0.70
4.3 PAR x Baseline (%NBS) _b	15%	15%
4.4 Percentage New Building Standard (%NBS) - Seismic Rating (Use lower of two values from Step 4.3)		15%

Step 5 - Is %NBS < 34?

YES

Step 6 - Potentially Earthquake Risk (is %NBS < 67)?

YES

Step 7 - Provisional Grading for Seismic Risk based on IEP

Seismic Grade

E

Additional Comments (items of note affecting IEP based seismic rating)

Relationship between Grade and %NBS:

Grade:	A+	A	B	C	D	E
%NBS:	> 100	100 to 80	79 to 67	66 to 34	< 34 to 20	< 20

WARNING!! This initial evaluation has been carried out solely as an initial seismic assessment of the building following the procedure set out in "The Seismic Assessment of Existing Buildings" Technical Guidelines for Engineering Assessments, July 2017. This spreadsheet must be read in conjunction with the limitations set out in the accompanying report, and should not be relied on by any party for any other purpose. Detailed inspections and engineering calculations, or engineering judgements based on them, have not been undertaken, and these may lead to a different result or seismic grade.

Initial Evaluation Procedure (IEP) Assessment - Completed for {Client/TA}

Page 7

Street Number & Name:	53 Esk Street	Job No.:	1711-2266
AKA:		By:	Matt Stewart
Name of building:	Max Fashion/Pascoes Building	Date:	2/04/2018
City:	Invercargill	Revision No.:	A

Table IEP-5 Initial Evaluation Procedure Step 8

Step 8 - Identification of potential Severe Structural Weaknesses (SSWs) that could result in significant risk to a significant number of occupants

8.1 Number of storeys above ground level

2

8.2 Presence of heavy concrete floors and/or concrete roof? (Y/N)

N

Potential Severe Structural Weaknesses (SSWs):

Note: Options that are greyed out are not applicable and need not be considered.

Occupancy not considered to be significant - no further consideration required•

Risk not considered to be significant - no further consideration required•

The following potential Severe Structural Weaknesses (SSWs) have been identified in the building that could result in significant risk to a significant number of occupants:

1. None identified
2. Weak or soft storey (except top storey)
3. Brittle columns and/or beam-column joints the deformations of which are not constrained by other structural elements
4. Flat slab buildings with lateral capacity reliant on low ductility slab-to-column connections
5. No identifiable connection between primary structure and diaphragms
6. Ledge and gap stairs

IEP Assessment Confirmed by  Signature

Andrew Marriott Name

72638 CPEng. No

WARNING!! This initial evaluation has been carried out solely as an initial seismic assessment of the building following the procedure set out in "The Seismic Assessment of Existing Buildings" Technical Guidelines for Engineering Assessments, July 2017. This spreadsheet must be read in conjunction with the limitations set out in the accompanying report, and should not be relied on by any party for any other purpose. Detailed inspections and engineering calculations, or engineering judgements based on them, have not been undertaken, and these may lead to a different result or seismic grade.

Initial Evaluation Procedure (IEP) Assessment - Completed for {Client/TA}

Page 1a

Street Number & Name:	53 Esk Street	Job No.:	1711-2266
AKA:		By:	Matt Stewart
Name of building:	Max Fashion/Pascoes Building	Date:	2/04/2018
City:	Invercargill	Revision No.:	A

Table IEP-1a Additional Photos and Sketches

Add any additional photographs, notes or sketches required below:

Note: print this page separately

WARNING!! This initial evaluation has been carried out solely as an initial seismic assessment of the building following the procedure set out "The Seismic Assessment of Existing Buildings" Technical Guidelines for Engineering Assessments, July 2017. This spreadsheet must be read in conjunction with the limitations set out in the accompanying report, and should not be relied on by any party for any other purpose. Detailed inspections and engineering calculations, or engineering judgements based on them, have not been undertaken, and these may lead to a different result or seismic grade.

Subject:

Out-of-plane Capacity of URM at Shopfront

URM Wall Properties

γ_{wall}	18	kN/m ³
$t_{w nom}$	0.325	m
$t_{w eff}$	0.319	m
$Q_{cladding}$	0	kPa
h	7	m
W	41.0	kN
e_b	0.109	m
y_b	3.50	m
γ	1.50	participation
T_p	2.14	sec
Δ_i	0.22	m
Δ_m	0.07	m
D_{ph}	0.42	m
%NBS	16	%

Anchorage Design

C_m	0.05	g
$C_{con(0.75)}$	0.05	g
F^*_{top}	1.9	kN

NZS 1170.5 (2004) parameters

Soil Class	D	
$C_h(0)$	1.12	From Table 3.1, use values in brackets
$N(T,D)$	1	Refer to Section 3.1.6
Z	0.17	Refer to Section 3.1.4
R	1	Refer to Section 3.1.5
$C(0)$	0.19	
R_p	1	From Table 8.1
h_n	10	m (Total Height)
h_i	6.5	m (Average height of part)
C_{Hi}	2.08	
$C_{hc}(T_p)$	0.62	
$C_p(T_p)$	0.25	

Case	Applicable	C_{Hi}
$h_i < 12$ m	YES	2.08333333
$h_i < 0.2h_n$	NO	N/A
$h_i \geq 0.2h_n$	YES	3

$C_p(0.75)$

$C_{hc}(0.75)$	1.48	g
$C_p(0.75)$	0.92	g

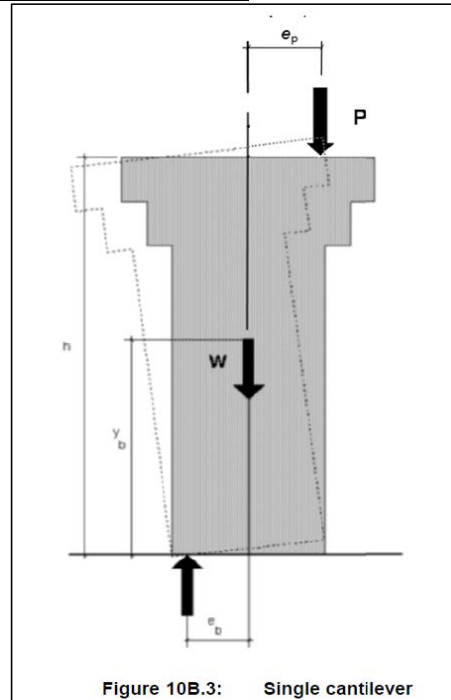


Figure 10B.3: Single cantilever